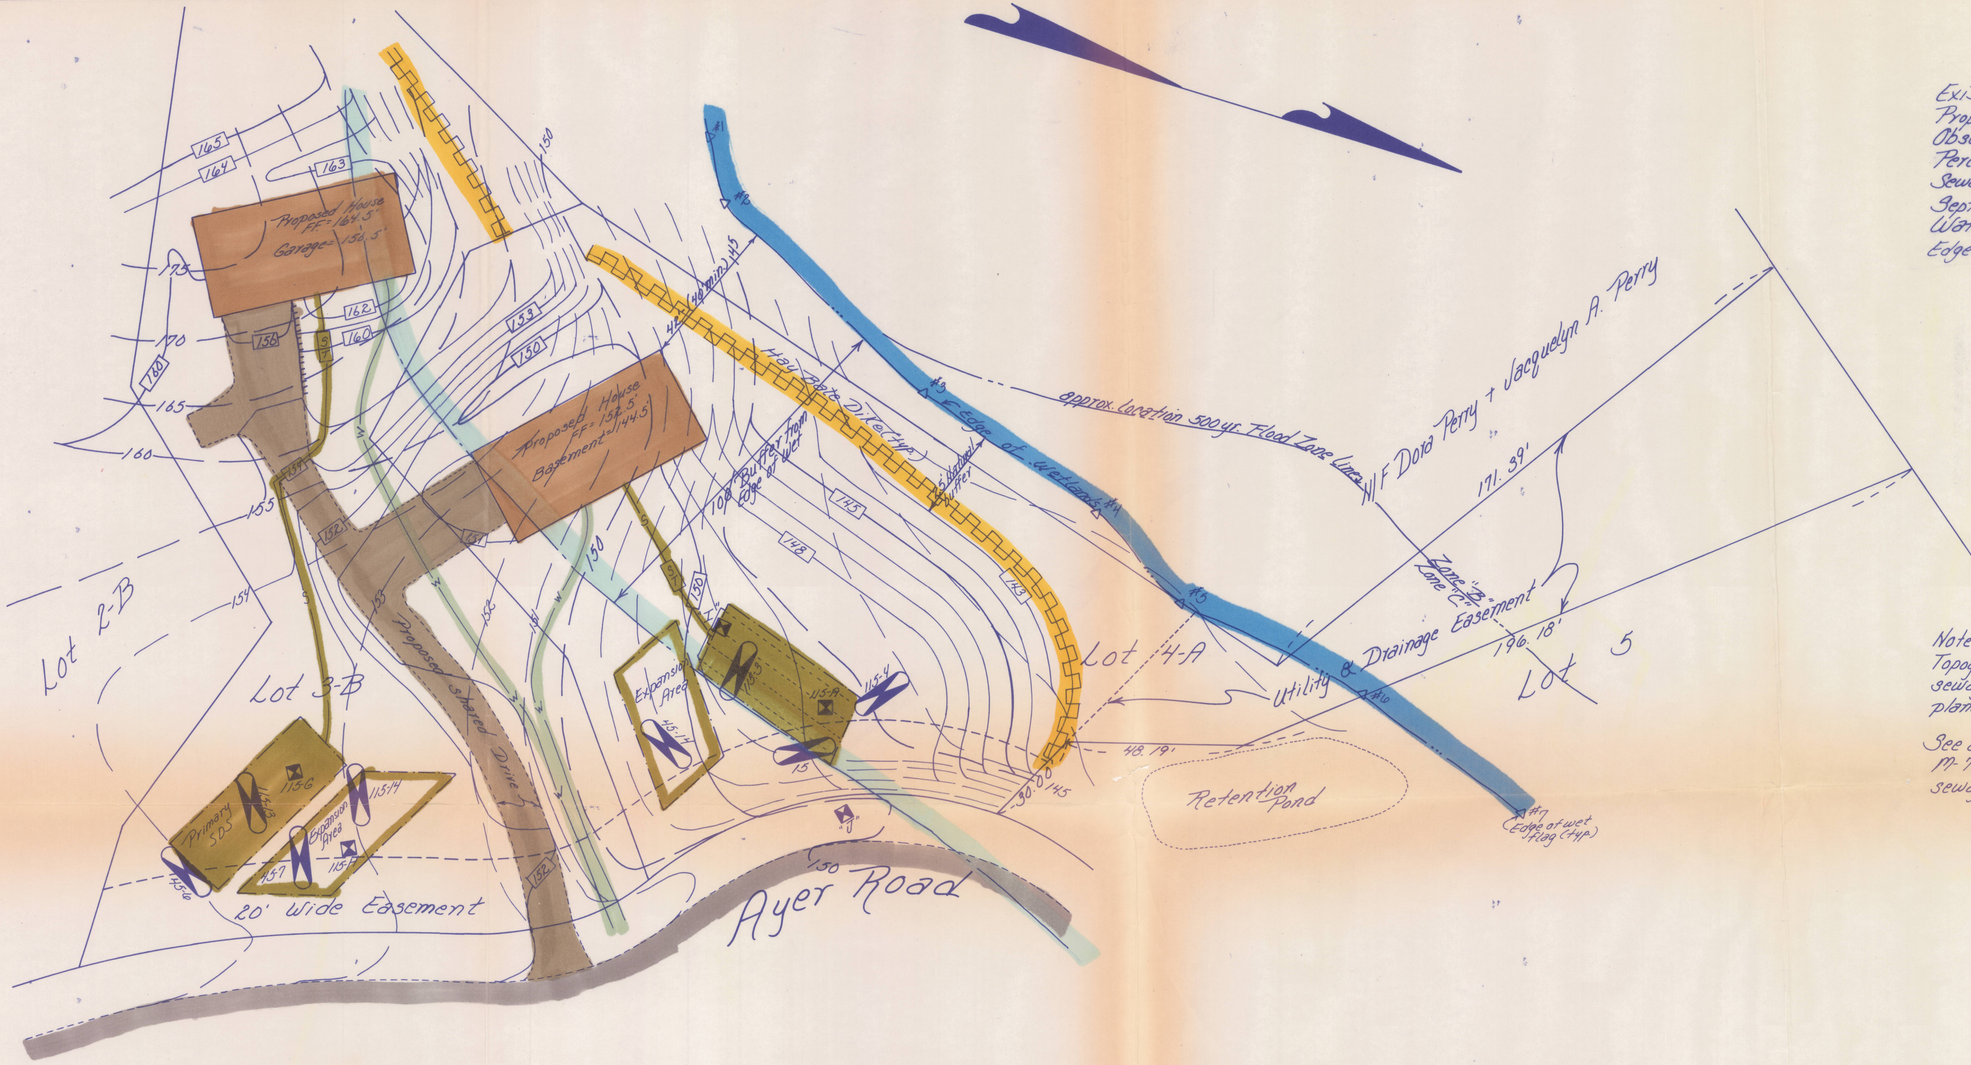

Legend

- Existing contour — 140
- Proposed contour — 140
- Observation hole
- Percolation test
- Sewage line — S — S
- Septic tank — ST
- Water service — W — W
- Edge of Pavement

Percolation rates - (min./inch)

	Rate	Depth	Date
"I"	2 min/in.	at 34" on	7-17-87
"J"	3 min/in.	at 45" on	7-17-87
115-A	2 min/in.	at 72" on	11-18-85

(By Charles A. Perkins Co., Inc.)

Note:
Topography, property lines and subsurface sewage disposal systems were taken from plans by Charles A. Perkins Co., Inc.

See above mentioned Perkins Plan No. M-7449-A and M-7448 for details of sewage disposal systems.

Soil Logs

115-3 147.4
Mixed Sand + Subsoil 144.9
Fine Sand ▽ 140.4 137.9

115-4 144.5
Mixed Sand + Subsoil 142.0
Fine Sand ▽ 139.0 137.5

Observed in Nov '85
(By Charles A. Perkins Co, Inc.)

#13 146.5
Top + Subsoil 145.5
Fine Sand 141.5
Sand + gravel 136.0
5-25-84

45-14 148.7
Top + Subsoil 147.2
Sand + gravel ▽ 140.2 139.7
4-19-85

4-19-85
45-6 152.0
Top + Subsoil 150.0
Sand oxidized 146.5
Fine Sand 140.5
N.E.W.O.

4-19-85
45-7 153.0
Top + Subsoil 151.5
Fine Sand oxidized 149.5
Sand 146.0
Fine Sand 141.0
N.E.W.O.

11-18-85
115-13 153.9
Top + Subsoil 151.9
Fine Sand
N.E.W.O. 142.9

11-18-85
115-14 153.5
Fine Sand 149.0
Gravel ▽ 145.5 143.5

Percolation rates (min/inch)

	Rate	Depth	Date
115-G	2 min/in.	at 72" on	11-18-85
115-H	2 min/in.	at 72" on	11-18-85

(Charles A. Perkins Co., Inc.)

COMMONWEALTH OF MASSACHUSETTS — DAVID EDWARD ROSS — No. 29202 — REGISTERED PROFESSIONAL ENGINEER — 3/30

Site Plan of Land in
Acton, Mass.
Prepared for
L+S Builders Corp.

SCALE: 1"=20' October, 1990

David E. Ross Associates, Inc.
CIVIL ENGINEERS
LAND SURVEYORS
ENVIRONMENTAL CONSULTANTS
P.O. Box 361-17 W. Main St.—Ayer, Mass. 01432
(TEL. NO. 508-772-6232)

JOB NO. 328 PLAN NO. L-354